

# MONUMENT RECORD

Corner ID: **Blm\_M21**

## Section Corner



Sections 27, 28, 33 & 34- T09N-R01W, 2nd P.M.  
Bloomington Township, Monroe County, Indiana

Section 28 T09N-R01W	Section 27 T09N-R01W
Section 33 T09N-R01W	Section 34 T09N-R01W

**MONUMENT:** Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)

Found 1" Iron Pin 0.2' below grade in 8" (Type C) Monument Box near intersecting centerlines of East 17<sup>th</sup> Street and Fee Lane.

### MONUMENT LOCATION SKETCH:

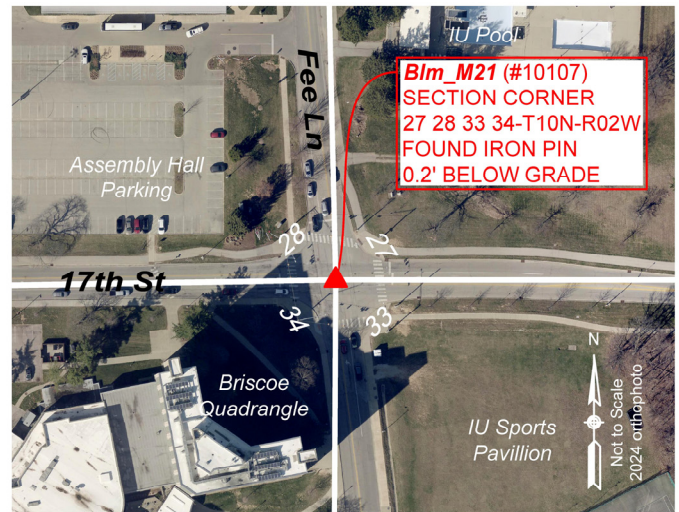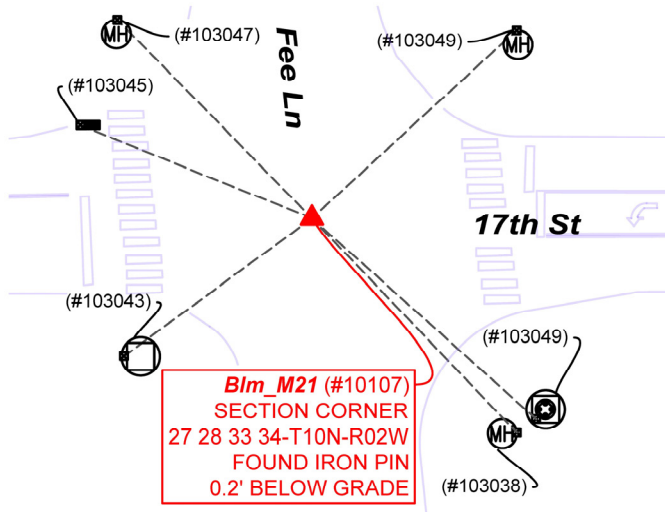

### MONUMENT ACCESSORIES

Survey grade monuments that were located in the vicinity and their relation to the monument.

(#103038)	S 43d38'44" E	77.26'	Cut X on west Flange Bolt of streetlight pole.
(#103041)	S 48d6'30" E	78.40'	Cut X on east side of 2.6' manhole rim for traffic signal.
(#103043)	S 53d39'37" W	60.67'	Cut X west side of 16" concrete pedestal that houses 8" cast iron cleanout.
(#103045)	N 68d7'28" W	64.86'	Cut X on west side of 6" x 36" curb inlet reading, "EJIW - MADE IN USA DUMP NO WASTE!" followed by an iron forged fish then reading, "DRAINS TO WATERWAY"
(#103047)	N 44d23'44" W	72.37'	Cut X on north side of 24" manhole rim with no markings but ridged.
(#103049)	N 47d25'12" E	72.34'	Cut X on north side of 2.6' manhole rim for traffic signal.
(#10073)	S 48d5'49" W	2662.19'	1" Iron Pin found in Monument Box 0.5' below grade <b>Blm_K21</b>
(#777)	S 89d41'51" E	5304.95'	Location of <b>Blm_Q21</b> Formerly a rebar but obliterated in course of new hospital construction. Coordinates provided by BRCJ.



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

Page 1 of 3



# MONUMENT RECORD

Corner ID: **Blm\_M21**

## Section Corner

Sections 27, 28, 33 & 34- T09N-R01W, 2nd P.M.  
Bloomington Township, Monroe County, Indiana

Section 28 T09N-R01W	Section 27 T09N-R01W
Section 33 T09N-R01W	Section 34 T09N-R01W

**PHOTO IDENTIFIED:** *Photo Date: 12/27/2023*



*Photo Orientation & Description:* Looking at Blm\_M21 from above.



*Photo Orientation & Description:* Looking west at Blm\_M21.



*Photo Orientation & Description:* Looking south at Blm\_M21.



*Photo Orientation & Description:* Looking north at Blm\_M21.

### ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND: *Include, search area or areas, search procedure, etc.*

*Date of Field work/Search:* 12/27/2023 *By:* JMG *Monument Found:* Iron Pin *BTs or Reference Objects Found:* n/a *Project #:* 3<sup>rd</sup> Street Offsets *Field Book:* 55/59 *Equipment:* The basis of bearings is Grid North System NAD83(2011)/Indiana West NAVD 88, Epoch 2010.0000, geoid12b\_conus.db3, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Coordinate data was collected with a Javad Triumph LS Network Rover. Coordinates are available upon request. *Notes:* All witness photos on file in the Monroe County Surveyors Office.

**OTHER EVIDENCE:** *Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.*

Monument located near intersecting centerlines of Fee Lane and 17<sup>th</sup> Street in a monument box. Intersection is perilous with brisk traffic, deceptive visibility and erratic traffic light changes. There is a nice pull off with a lowered curb southeast of the intersection +/- 75 feet.



**OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph**

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • [surveyorsoffice@co.monroe.in.us](mailto:surveyorsoffice@co.monroe.in.us)

Page 2 of 3

# MONUMENT RECORD

Corner ID: **Blm\_M21**

## Section Corner

Sections 27, 28, 33 & 34- T09N-R01W, 2nd P.M.  
Bloomington Township, Monroe County, Indiana

Section 28 T09N-R01W	Section 27 T09N-R01W
Section 33 T09N-R01W	Section 34 T09N-R01W

**MONUMENT PRESERVATION:** *Describe work done to preserve existing monument.*

**THEORY OF LOCATION:** *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*

The origin of the pin is unknown. It is believed that it have been established as part of a right of way project for INDOT. There is some uncertainty to this location, John Stapleton (in his Stone Book, page 55) has the centerline of East 10<sup>th</sup> street being on the E/W Centerline of Section 34. However, when measuring the west line of Section 34 from the northwest corner to the southwest corner, the midpoint is well north of the 10<sup>th</sup> Street centerline. References on File: A Susan M. Wood survey, Location Control Route Survey Plat Prepared for Indiana University (2018), on file at the Monroe County Recorder's office as 2018009840.IN, a Mark A Schepers survey, Location Route Control Survey, Dunn Street Pedestrian Connection (2021), on file at the Recorder's Office as 2021008567.IN and a Christopher L. Porter survey, Plat of Survey Monroe County Perpetuation (2023), on file at the Recorder's Office as 2024007408.IN . Historic research has not yet been performed to prove the validity of this monument.

### CERTIFICATION:



Date: 09/16/2025

Trohn Enright-Randolph

Monroe County Surveyor



Accepted by the Monroe  
County Surveyor Review  
Board on

09/16/25

